

Release Notes for Cisco RV120W Firmware Version 1.0.5.6

September 2013

These Release Notes describe the changes and known issues in Cisco RV120W firmware version 1.0.5.6.

IMPORTANT:

As with any firmware release, please read these release notes before upgrading the firmware. Cisco also recommends backing up your configuration before any firmware upgrade.

Contents

This document includes the following topics:

- Changes Since Firmware Release 1.0.4.10
- Known Issues in Release 1.0.5.6
- Related Information

Release Notes

Changes Since Firmware Release 1.0.4.10

Table 1 Resolved Issues in Firmware Version 1.0.5.6

Ref Number	Description
CSCts32168	When the DMZ is enabled, access to a device through the WAN is not allowed.
CSCty01349	When users clicked to reorder access rules, some rules may not be available for reordering while others may be duplicated.
CSCub58856	Firewall does not support IPv6.
CSCub59425	If a client has its IP address bound to a MAC address in the IP/MAC Binding table, firewall rules/filters enabled for the client no longer work. All traffic is allowed to pass from this client even though IP blocking/filtering for the client is enabled on the RV120W.
CSCua43141	DHCP Option 66 does not work if the TFTP server type is set to IP.
CSCtj73922/ CSCua04977	When Daylight Saving Time (DST) is enabled on Central European Time, the device shows Central European Summer Time (CEST) instead of Central Daylight Time (CDT).
CSCua43159	The device does not allow users to append the domain to a hostname when configuring DHCP Option 66. For example, the device will accept "MyHost" as a host name, but not "MyHost.example.com."
CSCua43166	When specifying the configuration file for Option 67, the Networking > LAN (Local Network) > Advanced DHCP Configuration page allows only files with a .cfg extension.

Known Issues in Release 1.0.5.6

Table 2 Known Issues in Firmware Version 1.0.5.6

Ref Number	Description
CSCui21565	Issue —The device considers the start IP address of the DHCP pool and static DHCP client invalid if it contains a 0 or 255 as the last number. For example, 10.0.1.0.
	Workaround—None.

 Table 2
 Known Issues in Firmware Version 1.0.5.6

Ref Number	Description	
CSCuj03033	Issue —The device does not allow users to add static routes with special next hop addresses such as 172.19.0.255.	
	Workaround—None.	
CSCuj13802	Issue —The device reboots when users click the Sys Summary menu 5 times per second or more.	
	Workaround—None.	
CSCub51099	Issue —Configuration and logging policies are lost after an upgrade. The RV120W loses the PPTP users and any specific logging options after the upgrade.	
	Workaround—None. You must reconfigure PPTP users after the upgrade.	
CSCtr76264	Issue —PPTP users can access the configuration utility even if remote management is disabled.	
	Workaround—None.	
CSCtu34004	Issue —Certain syslogs such as IKE and Kernel logs will appear with the timestamp of 2000-01-01 and not the current time.	
	Workaround—None.	
CSCub64446	Issue—DHCP option 150 does not work.	
	Workaround—Use option 66 and enter a hostname (without a domain name).	
CSCtj42903	Issue —When blocked keywords are configured in the Firewall page, users attempting to reach sites that use blocked keywords are redirected to the device login page instead of the appropriate warning page.	
	Workaround—None.	
CSCts24763	Issue —Changing the MTU value from the default value in the WAN window prevents clients from connecting to the Internet.	
	Workaround —None. Use the default MTU value (1500 bytes) to ensure that clients can connect to the Internet.	
CSCtu24324	Issue—QoS Profile Binding does not work properly for a selected service.	
	Workaround —Select the service type Any instead of selecting a particular service when configuring a QoS profile. QoS profile binding is then based on an IP address or a group of IP addresses.	

Release Notes

Related Information

Support				
Cisco Small Business	www.cisco.com/go/smallbizsupport			
Support Community				
Cisco Small Business	www.cisco.com/go/smallbizhelp			
Support and Resources				
Phone Support Contacts	www.cisco.com/en/US/support/			
	tsd_cisco_small_business			
	_support_center_contacts.html			
Cisco Small Business	www.cisco.com/go/software			
Firmware Downloads				
	Select a link to download firmware for Cisco Small			
	Business Products. No login is required.			
Product Documentation				
Cisco Small Business RV	www.cisco.com/go/smallbizrouters			
Series Routers				
Cisco Small Business				
Cisco Partner Central for	www.cisco.com/web/partners/sell/smb			
Small Business (Partner				
Login Required)				
Cisco Small Business	www.cisco.com/smb			
Home				

Cisco and the Cisco logo are trademarks or registered trademarks of Cisco and/or its affiliates in the U.S. and other countries. To view a list of Cisco trademarks, go to this URL: www.cisco.com/go/trademarks. Third-party trademarks mentioned are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (1110R)

© 2013 Cisco Systems, Inc. All rights reserved. 78-20884-02