

Cisco MDS 9000 Family Release Notes for Cisco MDS SVC Release 1.3(5m)

Date: May 29, 2007

Text Part Number: OL-6199-02

This document describes the caveats and limitations for the SAN Volume Controller Storage Software (SVC) for the Cisco MDS Caching Services Module (CSM). Use this document in conjunction with the documents listed in the “[Related Documentation](#)” section on [page 7](#).



Note

Releases notes are sometimes updated with new information on restrictions and caveats. Refer to the following website for the most recent version of the *Cisco MDS 9000 Family Release Note*:
http://www.cisco.com/en/US/products/hw/ps4159/ps4358/prod_release_notes_list.html

For information on IBM TotalStorage SAN Volume Controller Storage Software for the Cisco MDS 9000 Family, refer to the IBM TotalStorage Support website:
<http://www.ibm.com/storage/support/2062-2300/>

Contents

This document includes the following sections:

- [Introduction, page 2](#)
- [System Requirements, page 2](#)
- [Image Upgrade, page 3](#)
- [Compatibility Matrix, page 4](#)
- [CSM Backward Compatibility, page 4](#)
- [Caveats, page 5](#)
- [Related Documentation, page 7](#)

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

Introduction

The CSM provides virtualization services that allow the Cisco MDS 9000 Family switches to reallocate physical resources as virtual resources for increased efficiency. The CSM has two hard drives, two internal batteries for backup in case of power failure, and no external ports. The CSM receives and sends data through the switch backplane. The batteries on the CSM provide adequate power to back up data without external power.

Refer to the documents listed in the [“Related Documentation”](#) section on page 7.

System Requirements

This section describes the system requirements for Cisco MDS SVC Release 1.3(5m).

[Table 1](#) lists the hardware components supported by the Cisco MDS 9000 Family and the minimum software version required.

Table 1 Cisco MDS 9000 Family Supported Hardware Modules and Minimum Software Requirements

Component	Part Number	Description	Applicable Products
SAN-OS Software	M95S1K9-1.3.5	MDS 9500 Series supervisor/fabric-I, enterprise software	MDS 9500 Series only
	M92S1K9-1.3.5	MDS 9216 enterprise software	MDS 9216 only
SVC Software	SC-SVC-M9KS1K9	MDS SVC software	MDS 9500 Series and 9216
Chassis	DS-C9509	MDS 9509 director, base configuration (9-slot modular chassis includes 7 slots for switching modules and 2 slots for supervisor modules—SFPs sold separately)	MDS 9509 only
	DS-C9506	MDS 9506 director (6-slot modular chassis includes 4 slots for switching modules and 2 slots for supervisor modules—SFPs sold separately)	MDS 9506 only
	DS-C9216-K9	MDS 9216 16-port semi-modular fabric switch (includes 16-port 1 Gbps/2Gbps Fibre Channel ports, power supply, and expansion slot—SFPs sold separately)	MDS 9216 only
Supervisor modules	DS-X9530-SF1-K9	MDS 9500 supervisor/fabric-I, module	MDS 9500 Series only
Switching modules	DS-X9016	MDS 9000 16-port 1 Gbps/2Gbps Fibre Channel module (SFPs sold separately)	MDS 9500 Series and 9216
	DS-X9032	MDS 9000 32-port 2/1-Gbps Fibre Channel module (SFPs sold separately)	
Services modules	DS-X9308-SMIP	8-port Gigabit Ethernet IP storage services module	
	DS-X9304-SMIP	4-port Gigabit Ethernet IP storage services module	
	DS-X9560-SMC	Caching Services Module (CSM)	

Send documentation comments to mdsfeedback-doc@cisco.com

Table 1 Cisco MDS 9000 Family Supported Hardware Modules and Minimum Software Requirements (continued)

Component	Part Number	Description	Applicable Products
LC-type fiber-optic SFP ¹	DS-SFP-FC-2G-SW	2/1-Gbps Fibre Channel — short wave SFP	MDS 9000 Family
	DS-SFP-FC-2G-LW	2/1-Gbps Fibre Channel — long wave SFP	
	DS-SFP-FCGE-SW	1-Gbps Ethernet and 1 Gbps/2Gbps Fibre Channel—short wave SFP	
	DS-SFP-FCGE-LW	1-Gbps Ethernet and 1 Gbps/2Gbps Fibre Channel — long wave SFP	
CWDM ²	CWDM-SFP-xxxx-2G	Gigabit Ethernet and 1 Gbps/2Gbps Fibre Channel SFP LC interface xxxx nm, where xxxx = 1470, 1490, 1510, 1530, 1550, 1570, 1590, or 1610 nm	MDS 9000 Family
	CWDM-MUX-4	Add/drop multiplexer for 4 CWDM wavelengths	
	CWDM-MUX-8	Add/drop multiplexer for 8 CWDM wavelengths	
	CWDM-CHASSIS-2	Two slot chassis for CWDM add/drop multiplexer(s)	
Power supplies	DS-CAC-845W	845-W ³ AC power supply	MDS 9216 only
	DS-CAC-2500W	2500-W AC power supply	MDS 9509 only
	DS-CDC-2500W	2500-W DC power supply	
	DS-CAC-4000W-US	4000-W AC power supply for US (cable attached)	
	DS-CAC-4000W-INT	4000-W AC power supply international (cable attached)	MDS 9506 only
	DS-CAC-1900W	1900-W AC power supply	
	DS-CDC-1900W	1900-W DC power supply	
CompactFlash	MEM-MDS-FLD512M	MDS 9500 supervisor CompactFlash disk, 512 MB	MDS 9500 Series only
Port analyzer adapter	DS-PAA-2	A standalone Fibre Channel-to-Ethernet adapter that allows for simple, transparent analysis of Fibre Channel traffic in a switched fabric	MDS 9000 Family

1. SFP = small form-factor pluggable
2. CWDM = coarse wave division multiplexing
3. W = Watt

Image Upgrade

When CSMs are present in a Cisco MDS 9000 Family switch, several kinds of upgrade may be performed as required—a cluster software upgrade, an automatic upgrade when nodes are added, a service mode upgrade, or a switch software upgrade.

You can upgrade to Cisco SVC Release 1.3(5m) from Cisco SVC Release 1.3(4m).

Refer to the *Cisco MDS 9000 Family SAN Volume Controller Configuration Guide* for more information.

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

Compatibility Matrix

The latest Cisco MDS SAN-OS Release Compatibility Matrix for IBM SAN Volume Controller Software for Cisco MDS 9000 is available in the following Cisco Systems website.

http://www.cisco.com/en/US/products/hw/ps4159/ps4358/products_device_support_tables_list.html

CSM Backward Compatibility

The CSM is compatible with SAN-OS Release 1.3(x) and above. If you need to downgrade to Release 1.2(x) or earlier, you must power off the CSMs before performing the downgrade (see [CSCee69099](#)).

To revert to a release that is earlier than Release 1.3(x), follow these steps:

-
- Step 1** Power down all CSMs using the **poweroff module slot** command.
 - Step 2** Remove any CSMs related configuration (for example, clusters, back-end storage, virtual disks, and so forth).
Refer to the *Cisco MDS 9000 Family SAN Volume Controller Configuration Guide*.
 - Step 3** Save the configuration using the **copy running-config startup-config** command to save the new configuration into nonvolatile storage.
 - Step 4** Continue with the manual downgrade procedure.
Refer to the “Software Images” chapter in the *Cisco MDS 9000 Family Configuration Guide*.
-

New Features

Cisco SVC Release 1.3(5m) is a maintenance release for switches using CSM modules in the Cisco MDS 9000 Family. See the “Caveats” section on page 5 for details on closed and outstanding caveats and limitations.



Note

These Release Notes are specific to Release 1.3(5m). For the entire Release 1.3 documentation set, see the “Related Documentation” section on page 7.

Cisco SVC Release 1.3(5m) supports additional hardware for the SAN Volume Controller. Refer to the following URL for a list of supported operating systems, HBAs, and storage controllers:

<http://www-1.ibm.com/support/docview.wss?rs=539&uid=ssg1S1002375>

[Send documentation comments to mdsfeedback-doc@cisco.com](mailto:mdsfeedback-doc@cisco.com)

Limitations

The limitations and restrictions listed in this apply to all switches in the Cisco MDS 9000 Family that have CSMs installed:

Quorum Disks

If you issue a **quorum** command, regardless of the outcome of this new **quorum** command, you may lose your previously-configured quorum disk configuration. If you issue a new **quorum** command, be sure to verify your previous quorum configuration.

World Wide Names

The SVC functionality is only available when CSM modules are present in the switch. If you issue a **copy running startup** command when all CSM modules are removed (or powered-down), then SVC supervisor configurations associated with the CSM module, including world wide name (WWNs), may be discarded.

Caveats

This section lists the caveats and corrected caveats for this release. Use [Table 2](#) to determine the status of a particular caveat. In the table, “R” indicates a resolved caveat, and “O” indicates an open caveat.

Table 2 Release Caveats and Caveats Corrected Reference

DDTS Number	Software Release (Resolved or Open)	
	SVC 1.3(4m)	SVC 1.3(5m)
Severity 2		
CSCef04575	O	R
CSCee69099	O	O
Severity 3		
CSCee54650		R in SAN-OS 1.3(5)
CSCef21105		R in SAN-OS 1.3(5)
CSCef09470		R
CSCed14920		O

Resolved Caveats

- [CSCef04575](#)

Symptom: SAN-OS Release 1.3(4b) for the Cisco MDS 9000 Family is incompatible with Cisco MDS SVC Release 1.3(4m).

Workaround: None.

Send documentation comments to mdsfeedback-doc@cisco.com

- CSCee54650

Symptom: Under rare circumstances, it is possible to lose the cluster IP address when the config node fails. This problem is fixed in SAN-OS Release 1.3(5).

Workaround: For releases prior to SAN-OS 1.3(5):

- Connect to the switch using the switch's management IP address
- Use the **svc-config** and **show nodes** local commands to verify that the config node of the required cluster is present in that switch.
- Use the **svc-config**, **cluster config** *cluster-name*, and **ip** *new-ip-address* commands to change the cluster IP address for the cluster to another random address.
- Change the cluster IP address back to the original IP address using the same steps defined in Step c.

- CSCef21105

Symptom: The Cisco MDS 9500 supervisor module did not send a gratuitous ARP for CSM cluster IP address. This caused the host to lose connectivity to the Cluster IP address during a supervisor switchover. This problem is fixed in SAN-OS 1.3(5).

Workaround: For releases prior to SAN-OS 1.3(5), decrease the ARP cache timeout or manually delete the ARP entry for CSM cluster IP address at the host.

- CSCef09470

Symptom: A wrong Mdisk was being selected as the quorum disk in the command **quorum disk index** *mdisk mdisk-id*. Also, the quorum index assigned to the mdisk was wrong

Workaround: None.

Open Caveats

- CSCee69099

Symptom: If your current configuration is using CSMs and you need to downgrade from Release 1.3(x) or later to any release that is earlier than Release 1.3(1), do not issue the **install all** command before powering off the CSM(s).

Workaround: Explicitly power off the CSM before issuing the **install all** command. The CSM was only introduced in SAN-OS Release 1.3(x). See the [“CSM Backward Compatibility” section on page 4](#).

- CSCed14920

Symptom: During a switch upgrade, a SVC node may not save its entire state under rare circumstances. This results in that node not being part of the cluster after the switch upgrade. Verify this symptom by issuing the **show nodes local** command at the **svc-config** prompt—the command output displays the following information:

- The `cluster state` of the affected SVC node will be `unconfigured`.
- The `node state` of the affected SVC node will be `free`.

Workaround: Manually remove the SVC node from the cluster and then add the node back into the cluster. Refer to *Cisco MDS 9000 Family SAN Volume Controller Configuration Guide* for procedural details.

Send documentation comments to mdsfeedback-doc@cisco.com

Related Documentation

The documentation set for the Cisco MDS 9000 Family includes the following documents:

- *Cisco MDS 9000 Family Release Notes for Cisco MDS SAN-OS Releases*
- *Cisco MDS 9000 Family Interoperability Support Matrix*
- *Cisco MDS SAN-OS Release Compatibility Matrix for IBM SAN Volume Controller Software for Cisco MDS 9000*
- *Regulatory Compliance and Safety Information for the Cisco MDS 9000 Family*
- *Cisco MDS 9500 Series Hardware Installation Guide*
- *Cisco MDS 9216 Switch Hardware Installation Guide*
- *Cisco MDS 9100 Series Hardware Installation Guide*
- *Cisco MDS 9000 Family Configuration Guide*
- *Cisco MDS 9000 Family Command Reference*
- *Cisco MDS 9000 Family Fabric Manager Configuration Guide*
- *Cisco MDS 9000 Family SAN Volume Controller Configuration Guide*
- *Cisco MDS 9000 Family MIB Quick Reference*
- *Cisco MDS 9000 Family CIM Programming Reference Guide*
- *Cisco MDS 9000 Family System Messages Guide*
- *Cisco MDS 9000 Family Troubleshooting Guide*
- *Cisco MDS 9000 Family Port Analyzer Adapter 2 Installation and Configuration Note*
- *Cisco MDS 9000 Family Port Analyzer Adapter Installation and Configuration Note*

For information on IBM TotalStorage SAN Volume Controller Storage Software for the Cisco MDS 9000 Family, refer to the IBM TotalStorage Support website:

<http://www.ibm.com/storage/support/2062-2300/>

CSM—SVC Documentation

The following documents provide more information on the IBM TotalStorage SAN Volume Controller Storage Software (SVC) and the CSM.

- For CSM information, refer to the *Cisco MDS 9216 Switch Hardware Installation Guide* or the *Cisco MDS 9500 Family Hardware Installation Guide*.
- For SAN-OS CLI configuration information, refer to the *Cisco MDS 9000 Family SAN Volume Controller Configuration Guide*.
- For SAN-OS CLI commands, refer to the *Cisco MDS 9000 Family Command Reference*.
- For information on IBM TotalStorage SAN Volume Controller Storage Software for Cisco MDS 9000, refer to the following IBM documents available on the IBM TotalStorage Support web site: <http://www.ibm.com/storage/support/2062-2300/>
 - Getting Started—*IBM TotalStorage SAN Volume Controller Storage Software for Cisco MDS 9000*
 - Configuration Guide—*IBM TotalStorage SAN Volume Controller Storage Software for Cisco MDS 9000*

Send documentation comments to mdsfeedback-doc@cisco.com

- Supported Hardware List—*IBM TotalStorage SAN Volume Controller Storage Software for Cisco MDS 9000*
- Supported Software Levels—*IBM TotalStorage SAN Volume Controller Storage Software for Cisco MDS 9000*
- Command Line Interface User's Guide—*IBM TotalStorage SAN Volume Controller Storage Software for Cisco MDS 9000*
- Host Attachment Guide—*IBM TotalStorage SAN Volume Controller Storage Software*
- User Guide—*Subsystem Device Driver User's Guide*

Obtaining Documentation

Cisco documentation and additional literature are available on Cisco.com. Cisco also provides several ways to obtain technical assistance and other technical resources. These sections explain how to obtain technical information from Cisco Systems.

Cisco.com

You can access the most current Cisco documentation at this URL:

<http://www.cisco.com/univercd/home/home.htm>

You can access the Cisco website at this URL:

<http://www.cisco.com>

You can access international Cisco websites at this URL:

http://www.cisco.com/public/countries_languages.shtml

Ordering Documentation

You can find instructions for ordering documentation at this URL:

http://www.cisco.com/univercd/cc/td/doc/es_inpk/pdi.htm

You can order Cisco documentation in these ways:

- Registered Cisco.com users (Cisco direct customers) can order Cisco product documentation from the Ordering tool:
<http://www.cisco.com/en/US/partner/ordering/index.shtml>
- Nonregistered Cisco.com users can order documentation through a local account representative by calling Cisco Systems Corporate Headquarters (California, USA) at 408 526-7208 or, elsewhere in North America, by calling 800 553-NETS (6387).

Send documentation comments to mdsfeedback-doc@cisco.com

Documentation Feedback

You can send comments about technical documentation to mdsfeedback-doc@cisco.com.

You can submit comments by using the response card (if present) behind the front cover of your document or by writing to the following address:

Cisco Systems
Attn: Customer Document Ordering
170 West Tasman Drive
San Jose, CA 95134-9883

We appreciate your comments.

Obtaining Technical Assistance

For all customers, partners, resellers, and distributors who hold valid Cisco service contracts, Cisco Technical Support provides 24-hour-a-day, award-winning technical assistance. The Cisco Technical Support Website on Cisco.com features extensive online support resources. In addition, Cisco Technical Assistance Center (TAC) engineers provide telephone support. If you do not hold a valid Cisco service contract, contact your reseller.

Cisco Technical Support Website

The Cisco Technical Support Website provides online documents and tools for troubleshooting and resolving technical issues with Cisco products and technologies. The website is available 24 hours a day, 365 days a year at this URL:

<http://www.cisco.com/techsupport>

Access to all tools on the Cisco Technical Support Website requires a Cisco.com user ID and password. If you have a valid service contract but do not have a user ID or password, you can register at this URL:

<http://tools.cisco.com/RPF/register/register.do>

Submitting a Service Request

Using the online TAC Service Request Tool is the fastest way to open S3 and S4 service requests. (S3 and S4 service requests are those in which your network is minimally impaired or for which you require product information.) After you describe your situation, the TAC Service Request Tool automatically provides recommended solutions. If your issue is not resolved using the recommended resources, your service request will be assigned to a Cisco TAC engineer. The TAC Service Request Tool is located at this URL:

<http://www.cisco.com/techsupport/servicerequest>

For S1 or S2 service requests or if you do not have Internet access, contact the Cisco TAC by telephone. (S1 or S2 service requests are those in which your production network is down or severely degraded.) Cisco TAC engineers are assigned immediately to S1 and S2 service requests to help keep your business operations running smoothly.

Send documentation comments to mdsfeedback-doc@cisco.com

To open a service request by telephone, use one of the following numbers:

Asia-Pacific: +61 2 8446 7411 (Australia: 1 800 805 227)

EMEA: +32 2 704 55 55

USA: 1 800 553 2447

For a complete list of Cisco TAC contacts, go to this URL:

<http://www.cisco.com/techsupport/contacts>

Definitions of Service Request Severity

To ensure that all service requests are reported in a standard format, Cisco has established severity definitions.

Severity 1 (S1)—Your network is “down,” or there is a critical impact to your business operations. You and Cisco will commit all necessary resources around the clock to resolve the situation.

Severity 2 (S2)—Operation of an existing network is severely degraded, or significant aspects of your business operation are negatively affected by inadequate performance of Cisco products. You and Cisco will commit full-time resources during normal business hours to resolve the situation.

Severity 3 (S3)—Operational performance of your network is impaired, but most business operations remain functional. You and Cisco will commit resources during normal business hours to restore service to satisfactory levels.

Severity 4 (S4)—You require information or assistance with Cisco product capabilities, installation, or configuration. There is little or no effect on your business operations.

Obtaining Additional Publications and Information

Information about Cisco products, technologies, and network solutions is available from various online and printed sources.

- Cisco Marketplace provides a variety of Cisco books, reference guides, and logo merchandise. Visit Cisco Marketplace, the company store, at this URL:

<http://www.cisco.com/go/marketplace/>

- The Cisco *Product Catalog* describes the networking products offered by Cisco Systems, as well as ordering and customer support services. Access the Cisco Product Catalog at this URL:

<http://cisco.com/univercd/cc/td/doc/pcat/>

- *Cisco Press* publishes a wide range of general networking, training and certification titles. Both new and experienced users will benefit from these publications. For current Cisco Press titles and other information, go to Cisco Press at this URL:

<http://www.ciscopress.com>

- *Packet* magazine is the Cisco Systems technical user magazine for maximizing Internet and networking investments. Each quarter, Packet delivers coverage of the latest industry trends, technology breakthroughs, and Cisco products and solutions, as well as network deployment and troubleshooting tips, configuration examples, customer case studies, certification and training information, and links to scores of in-depth online resources. You can access Packet magazine at this URL:

<http://www.cisco.com/packet>

Send documentation comments to mdsfeedback-doc@cisco.com

- *iQ Magazine* is the quarterly publication from Cisco Systems designed to help growing companies learn how they can use technology to increase revenue, streamline their business, and expand services. The publication identifies the challenges facing these companies and the technologies to help solve them, using real-world case studies and business strategies to help readers make sound technology investment decisions. You can access iQ Magazine at this URL:

<http://www.cisco.com/go/iqmagazine>

- *Internet Protocol Journal* is a quarterly journal published by Cisco Systems for engineering professionals involved in designing, developing, and operating public and private internets and intranets. You can access the Internet Protocol Journal at this URL:

<http://www.cisco.com/ipj>

- World-class networking training is available from Cisco. You can view current offerings at this URL:

<http://www.cisco.com/en/US/learning/index.html>

CCVP, the Cisco logo, and the Cisco Square Bridge logo are trademarks of Cisco Systems, Inc.; Changing the Way We Work, Live, Play, and Learn is a service mark of Cisco Systems, Inc.; and Access Registrar, Aironet, BPX, Catalyst, CCDA, CCDP, CCIE, CCIP, CCNA, CCNP, CCSP, Cisco, the Cisco Certified Internetwork Expert logo, Cisco IOS, Cisco Press, Cisco Systems, Cisco Systems Capital, the Cisco Systems logo, Cisco Unity, Enterprise/Solver, EtherChannel, EtherFast, EtherSwitch, Fast Step, Follow Me Browsing, FormShare, GigaDrive, HomeLink, Internet Quotient, IOS, iPhone, IP/TV, iQ Expertise, the iQ logo, iQ Net Readiness Scorecard, iQuick Study, LightStream, Linksys, MeetingPlace, MGX, Networking Academy, Network Registrar, *Packet*, PIX, ProConnect, ScriptShare, SMARTnet, StackWise, The Fastest Way to Increase Your Internet Quotient, and TransPath are registered trademarks of Cisco Systems, Inc. and/or its affiliates in the United States and certain other countries.

All other trademarks mentioned in this document or Website are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (0705R)

Send documentation comments to mdsfeedback-doc@cisco.com